

INITIAL MAINTENANCE

Begin 48 hours after installation

Install and maintain entry matting with a non-staining backing to reduce tracked-in dirt and contaminants.

LONSEAL FLOORCARE




ALWAYS WEAR GOGGLES, GLOVES AND SLIP RESISTANT SHOES WHEN USING THIS PRODUCT.

CLEAN


LONSEAL
FLOORCARE

LONCARE


NEUTRAL pH FLOOR CLEANER FOR
RESILIENT SHEET VINYL

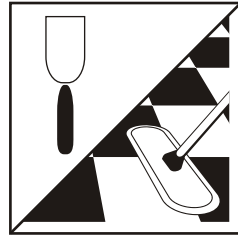


1. Remove dry soils (labels, gum). Sweep or microfiber dust mop floor. Place "Wet Floor" signs in area.

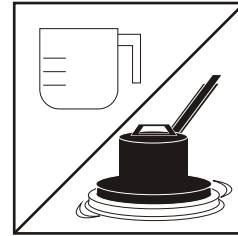

2. Dilute **LONCARE** 2oz. per gallon of cold tap water. Scrub with blue pad on auto scrubber or single disk machine.

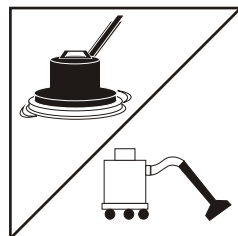

3. Pick up cleaning solution with scrubber or wet vac. (Replace solution when mop water becomes dirty.)

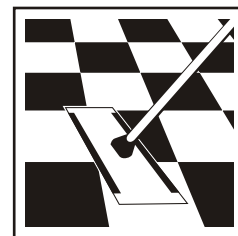


4. Using a clean microfiber mop pad, damp mop any residue with clean water. Allow floor to dry completely.

PRIME


LONSEAL
FLOORCARE

LONPRIME

BASE SEAL COAT FOR
RESILIENT SHEET VINYL

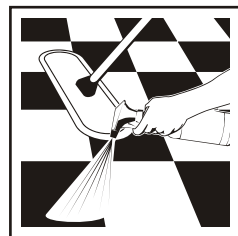

5. Apply **LONPRIME** in one thin coat using a clean microfiber mop pad. Application of **LONPRIME** as a base seal coat increases the adhesion of the floor finish to the floor.

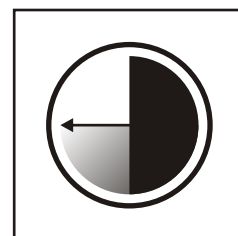

6. Allow to dry completely before applying floor finish. Dry time is subject to temperature and humidity.

FINISH

LONSEAL
FLOORCARE

LONFINISH

ULTRA HIGH SPEED FINISH
SUPERIOR UHS FORMULATION
FOR RESILIENT SHEET VINYL




OR


LONSEAL
FLOORCARE

LONSATIN


MATTE FLOOR FINISH
FOR RESILIENT SHEET VINYL

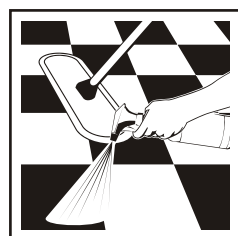

7. Apply **LONFINISH** or **LONSATIN** in a thin coat using a clean microfiber mop pad.

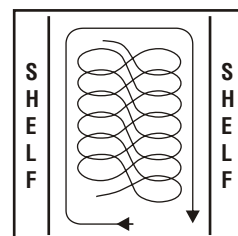

8. To apply a full even coat, outline the area to be finished. Fill in the outlined area using a figure eight motion. Ensure perimeter and edges are completely coated.

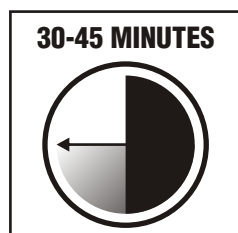

9. Apply a minimum of 2-4 coats. Allow 30-45 minutes between coats. For highly embossed and *porous products, 4 coats of floor finish is highly recommended.

*Loneco, Lonfloor Galvanized and Lonfloor Vista

LONSEAL, INC.

STANDARD FINISH

Install and maintain entry matting with a non-staining backing to reduce tracked-in dirt and contaminants.

LONSEAL FLOORCARE

ROUTINE/DAILY MAINTENANCE




ALWAYS WEAR GOGGLES, GLOVES AND SLIP RESISTANT SHOES WHEN USING THIS PRODUCT.




CLEAN



1. Remove gross soils (labels, gum). Sweep or microfiber dust mop floor. Place "Wet Floor" signs in area.

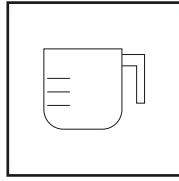

2. Dilute LONCARE 2oz. per gallon of cold tap water. (Replace solution when mop water becomes dirty)

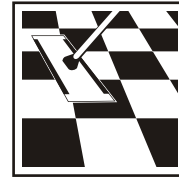

3. Apply to finished floors using a clean microfiber mop pad or autoscrubber. Allow floor to dry completely.



4. When dry, if needed, burnish with ultra high speed machine and blue ice pad to high gloss. Never burnish with a soiled pad.




PERIODIC Scrub and Recoat (as needed)




ALWAYS WEAR GOGGLES, GLOVES AND SLIP RESISTANT SHOES WHEN USING THIS PRODUCT.



SCRUB

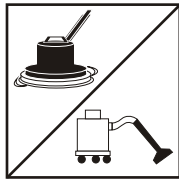

1. Dilute LONCARE 2oz. per gallon of cold tap water. Scrub with blue pad on auto scrubber or single disk machine. Pick up cleaning solution with scrubber or wet vac. (Replace solution when mop water becomes dirty.)

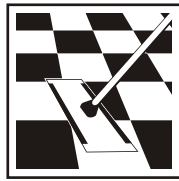

2. Using a clean microfiber mop pad, damp mop any residue with clean water. Allow floor to dry completely.

RECOAT




3. Apply LONFINISH or LONSATIN in a thin coat using a clean microfiber mop pad. To apply a full even coat, outline the area to be finished. Fill in the outlined area using a figure eight motion. Ensure perimeter and edges are completely coated.



4. Apply a minimum of 2-4 coats. Allow 30-45 minutes between coats. For highly embossed and *porous products, 4 coats of floor finish is highly recommended. (To keep clean follow DAILY MAINTENANCE directions.)

*Loneco, Lonfloor Galvanized and Lonfloor Vista

RESTORATIVE Strip and Finish (as needed)

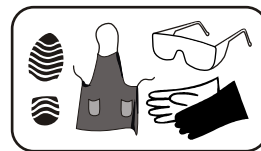


ALWAYS WEAR GOGGLES, GLOVES AND SLIP RESISTANT SHOES WHEN USING THIS PRODUCT.




STRIP




1. Sweep to remove gross soils. Divide work areas into small 5x20' areas. Dilute 1 part LONSTRIP with 5 parts water. Apply enough stripper to ensure complete wetting.

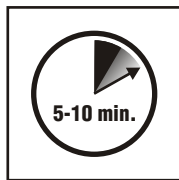

2. Allow to stand 5-10 minutes minimum. DO NOT ALLOW SOLUTION TO DRY. Re-wet as needed.

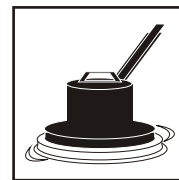


3. Scrub floor with auto scrubber or floor machine using a brown stripping pad to break softened film. Flip pad and replace as needed.

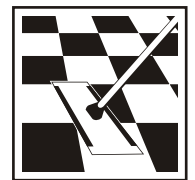

4. Pick up solution with wet vac or auto scrubber. Damp mop floor with clean water and microfiber mop pad to remove all residue. Allow to dry completely prior to applying LONPRIME.



SEAL

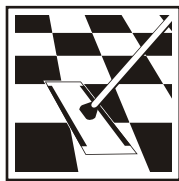


1. Apply LONPRIME in one thin coat using a clean microfiber mop pad. Application of LONPRIME as a base seal coat increases the adhesion of the floor finish to the floor. Allow to dry completely before applying floor finish.

FINISH



2. Apply LONFINISH or LONSATIN in a thin coat using a clean microfiber mop pad.

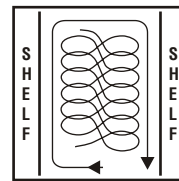

3. To apply a full even coat, outline the area to be finished. Fill in the outlined area using a figure eight motion. Ensure perimeter and edges are completely coated.



4. Apply a minimum of 2-4 coats. Allow 30-45 minutes between coats. For highly embossed and *porous products, 4 coats of floor finish is highly recommended.

*Loneco, Lonfloor Galvanized and Lonfloor Vista

LONSEAL, INC.